*PLDP Maintenance



* Customers can put some grease on pivot points(red circle place), with brass or gunmetal bushings.






* Let’s maintain your machine!


PLDP.5 HARDWARE

(shown in actual size)


A[1PCS]

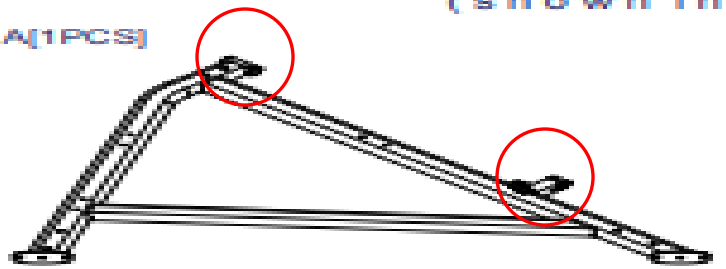

B[1PCS]

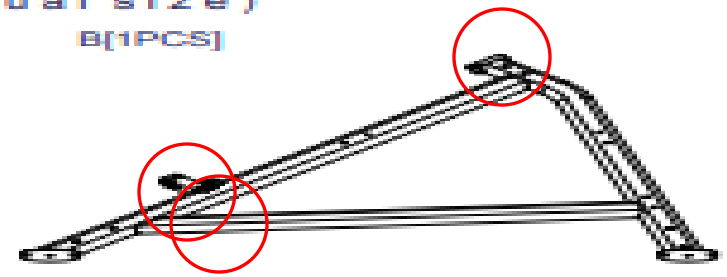


C[1PCS]



D[1PCS]




E[1PCS]

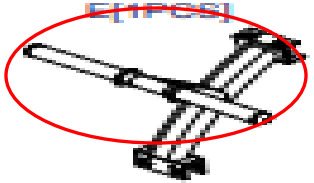

H[1PCS]



F[1PCS]

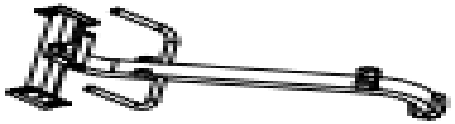

G[1PCS]



I[1PCS]



J[1PCS]



K[1PCS]



N[1PCS]



M[1PCS]



O[1PCS]



P[1PCS]



Q[1PCS]
(6730-005)



S[2PCS]
(8342-048)



T[4PCS]
(8323-234)




U[2PCS]
(8312-165)



Y[1PCS]
(9121-104)




V[2PCS]
(8280-025)

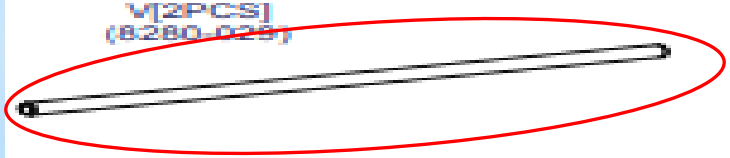


Z[1PCS]
(9111-082)




STEP 1

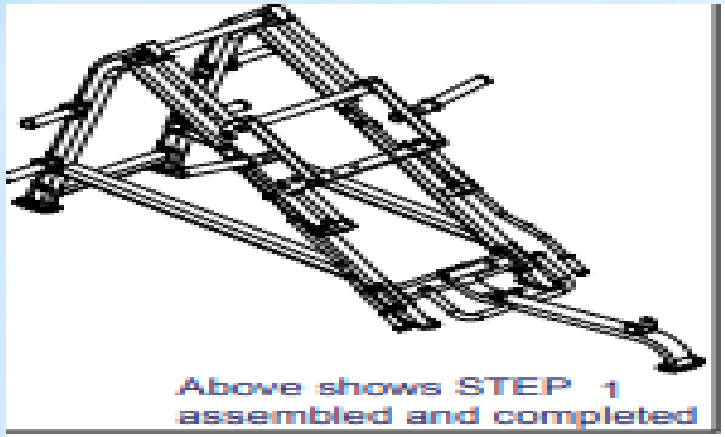


Above shows STEP 1 assembled and completed

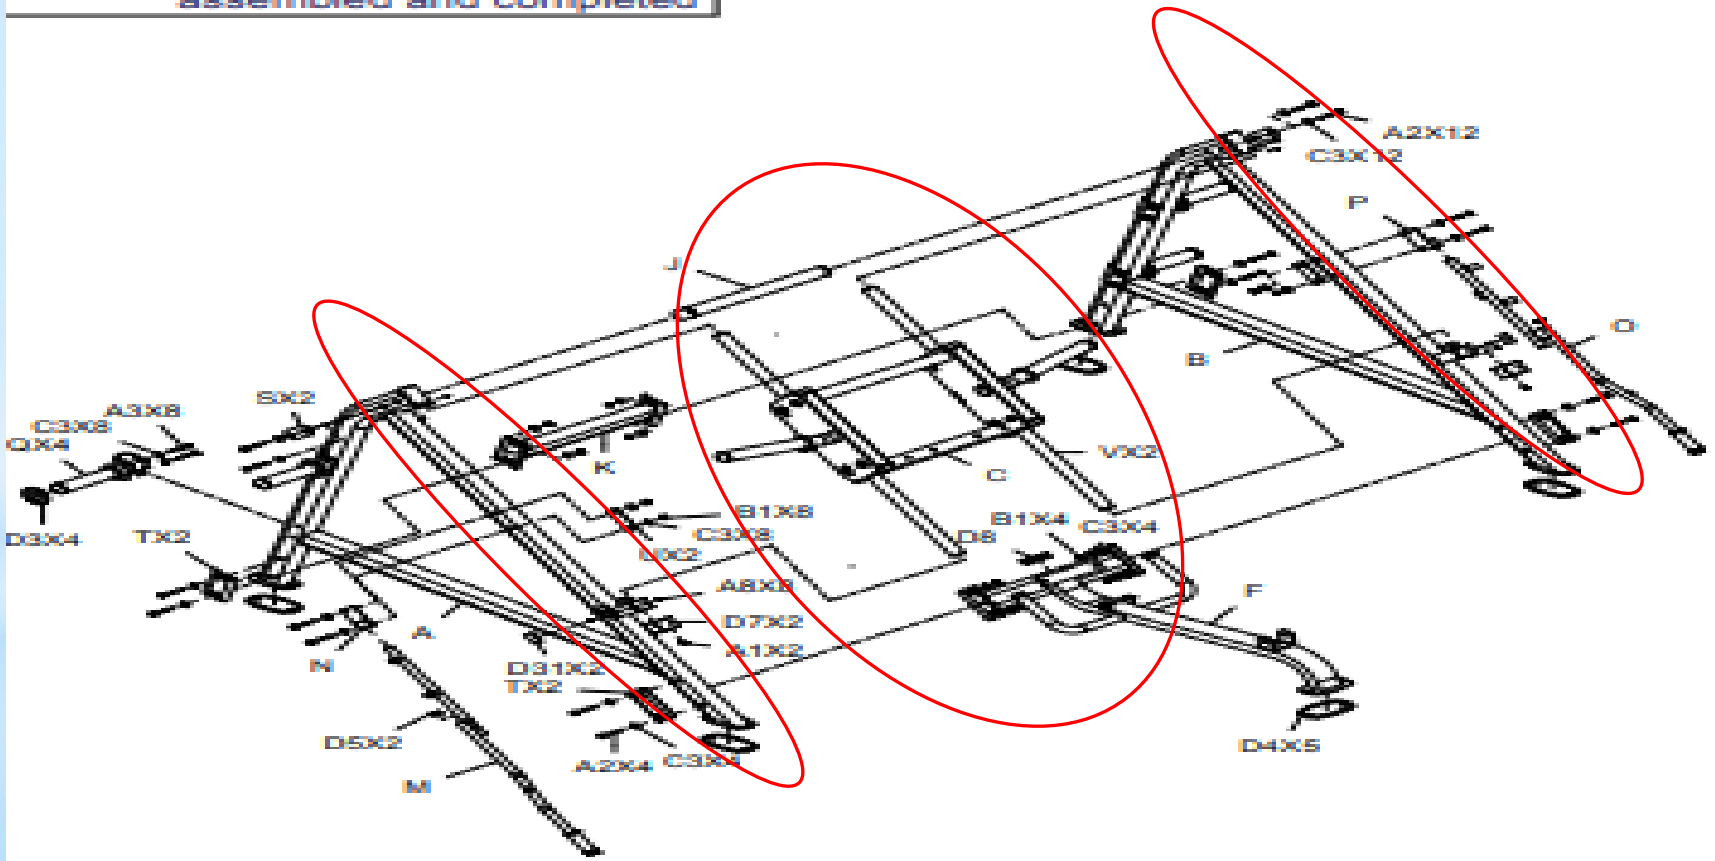


STEP 2

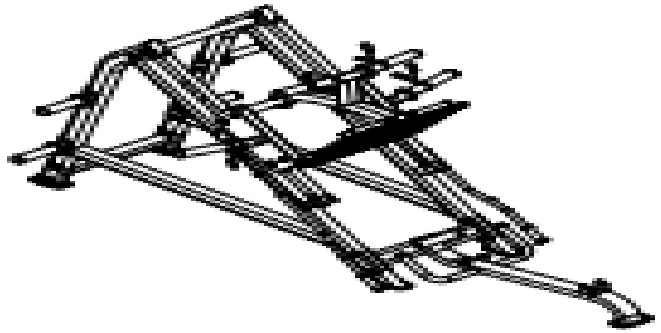


Above shows STEP 2 assembled and completed

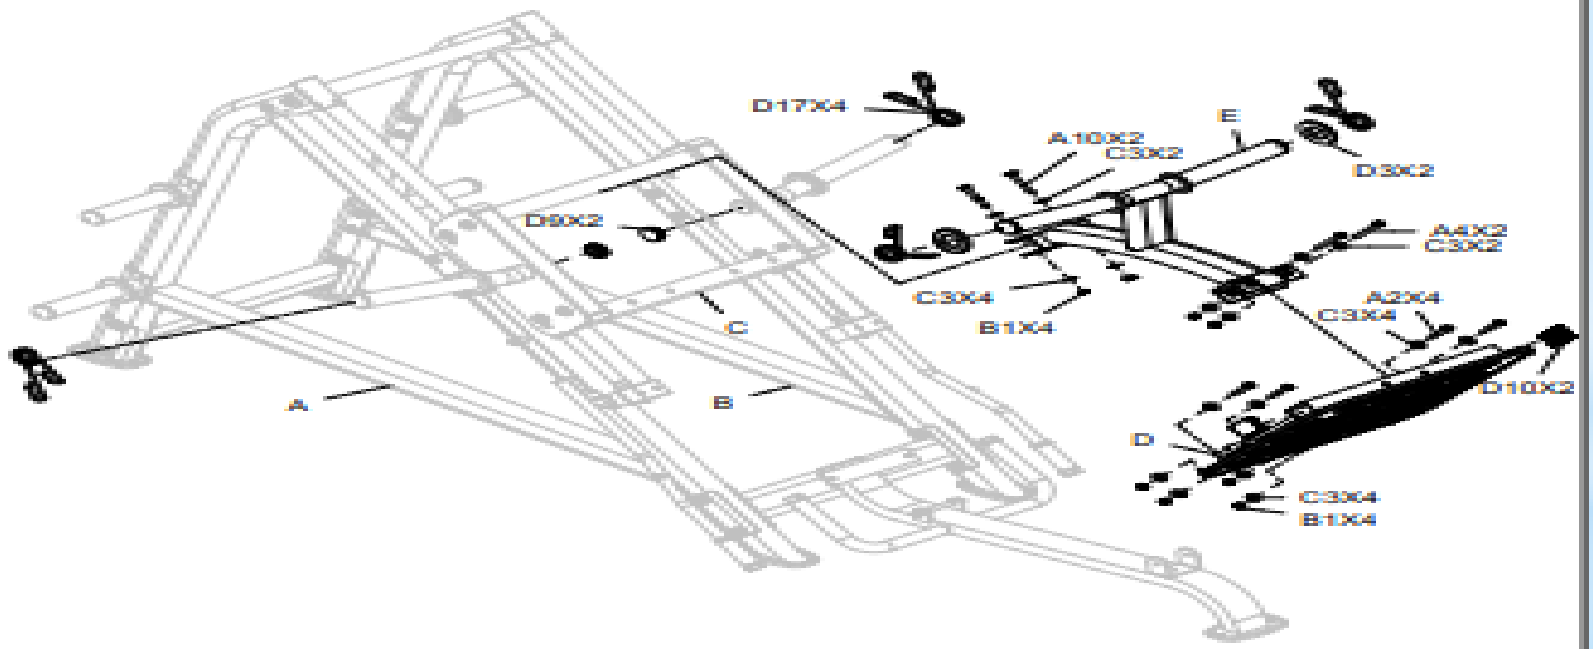


STEP
3

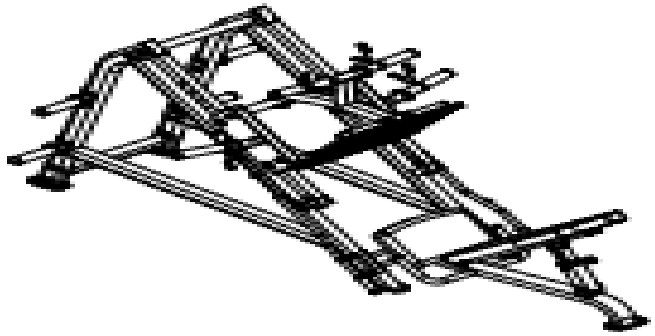

Above shows STEP 3
assembled and completed

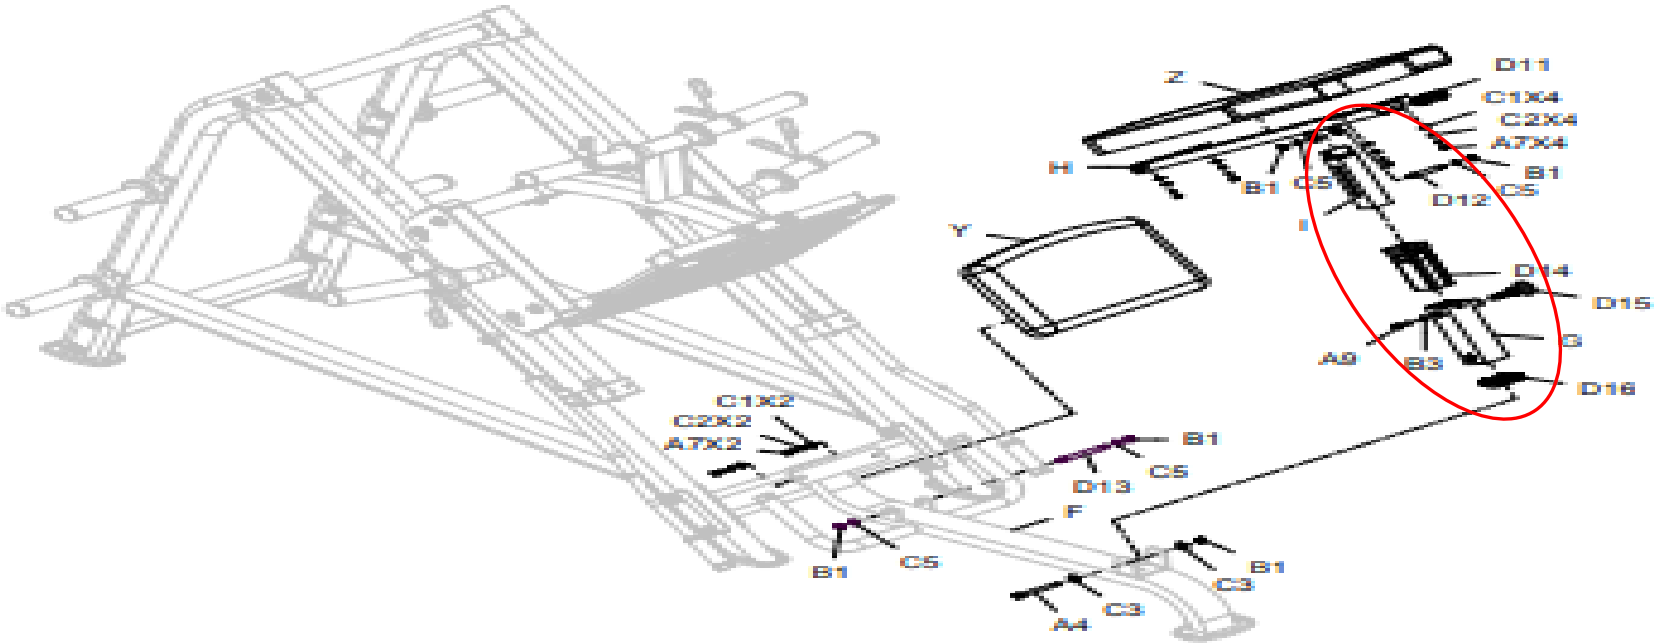

PLDP.5

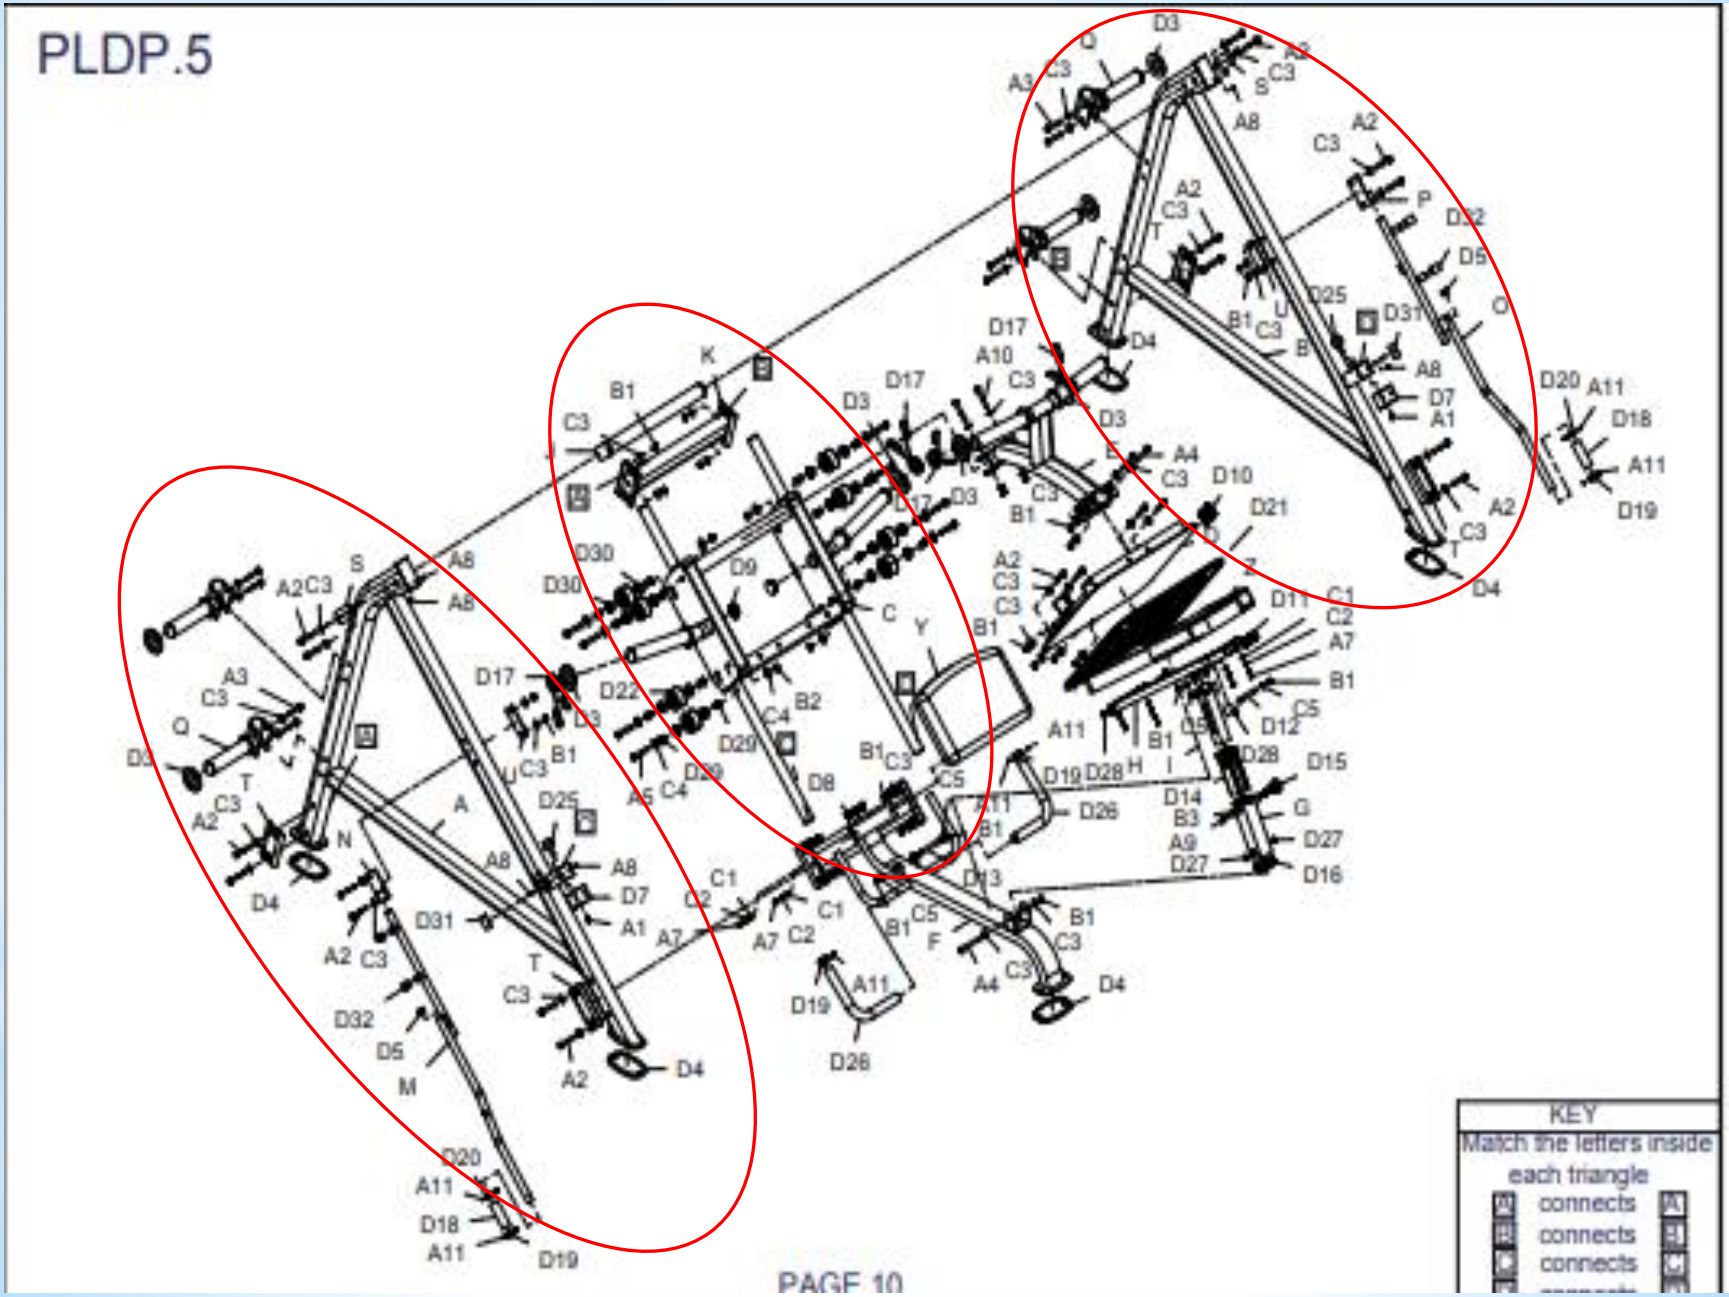
KEY
Match the letters inside each triangle
connects
connects
connects

*Well done!

