*PLHP Maintenance



* Customers can put some grease on pivot points(red circle place), with brass or gunmetal bushings.







* Let’s maintain your machine!

PCRPCS HARDWARE
(shown in actual size)


A[1PCS]

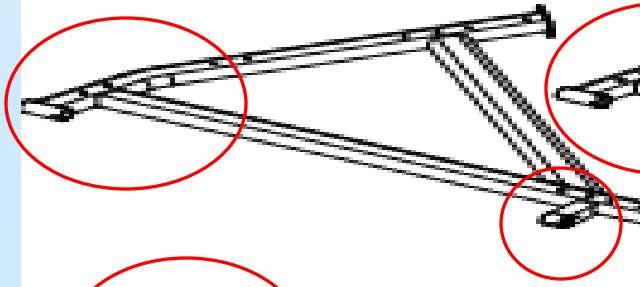


B[1PCS]

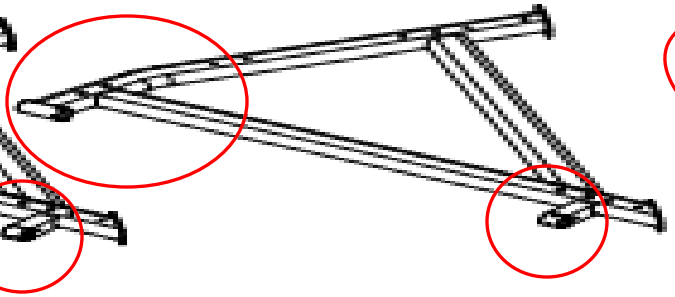


C[1PCS]

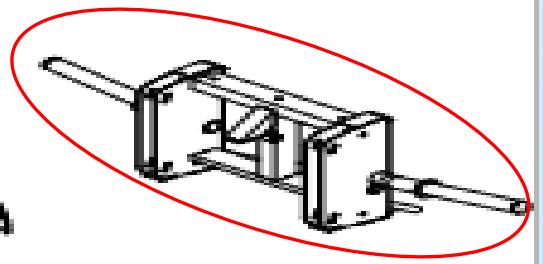


D[1PCS]

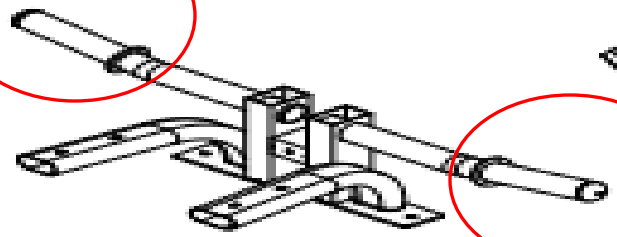


FA[1PCS]

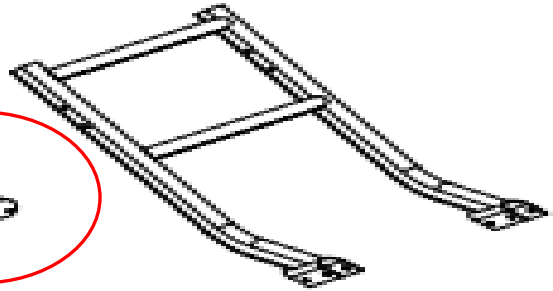


FB[1PCS]

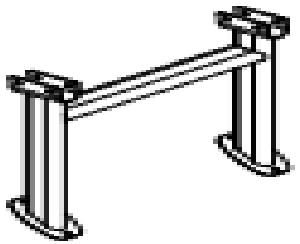

G[1PCS]

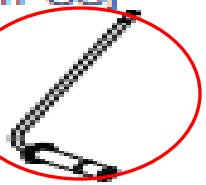


H[1PCS]

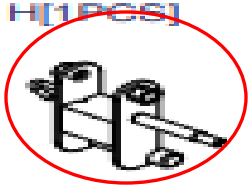


K[1PCS]



_[1PCS]

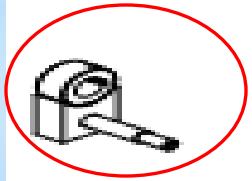

M[1PCS]

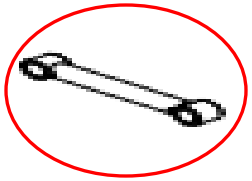

O[1PCS]



Z[1PCS]




PLHP.5 HARDWARE
(shown in actual size)

S[2PCS]
8280-030

J[4PCS]
6730035



P[2PCS]
8323-234




W[4PCS]
8342-048




N[2PCS]
9131-054



Q[1PCS]
9111-092

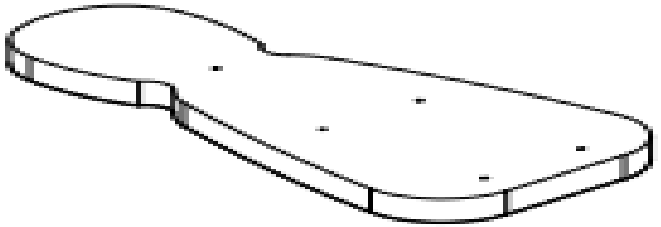


X[2PCS]
8343-305

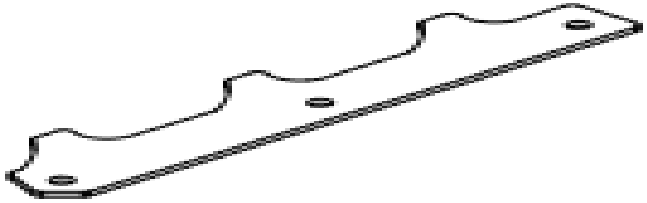


Y[2PCS]
8312-013




Z1[1PCS]
9310-095

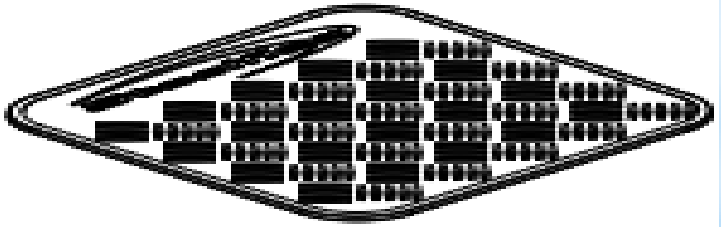


STEP 1

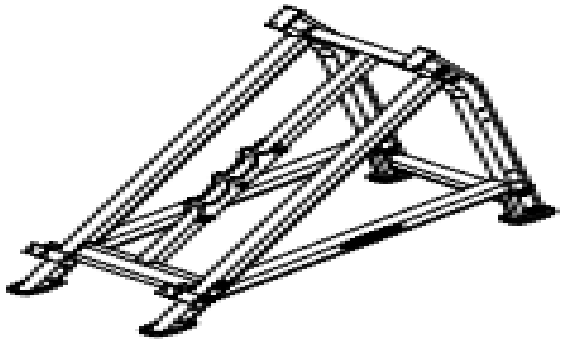


Above shows STEP 1
assembled and completed

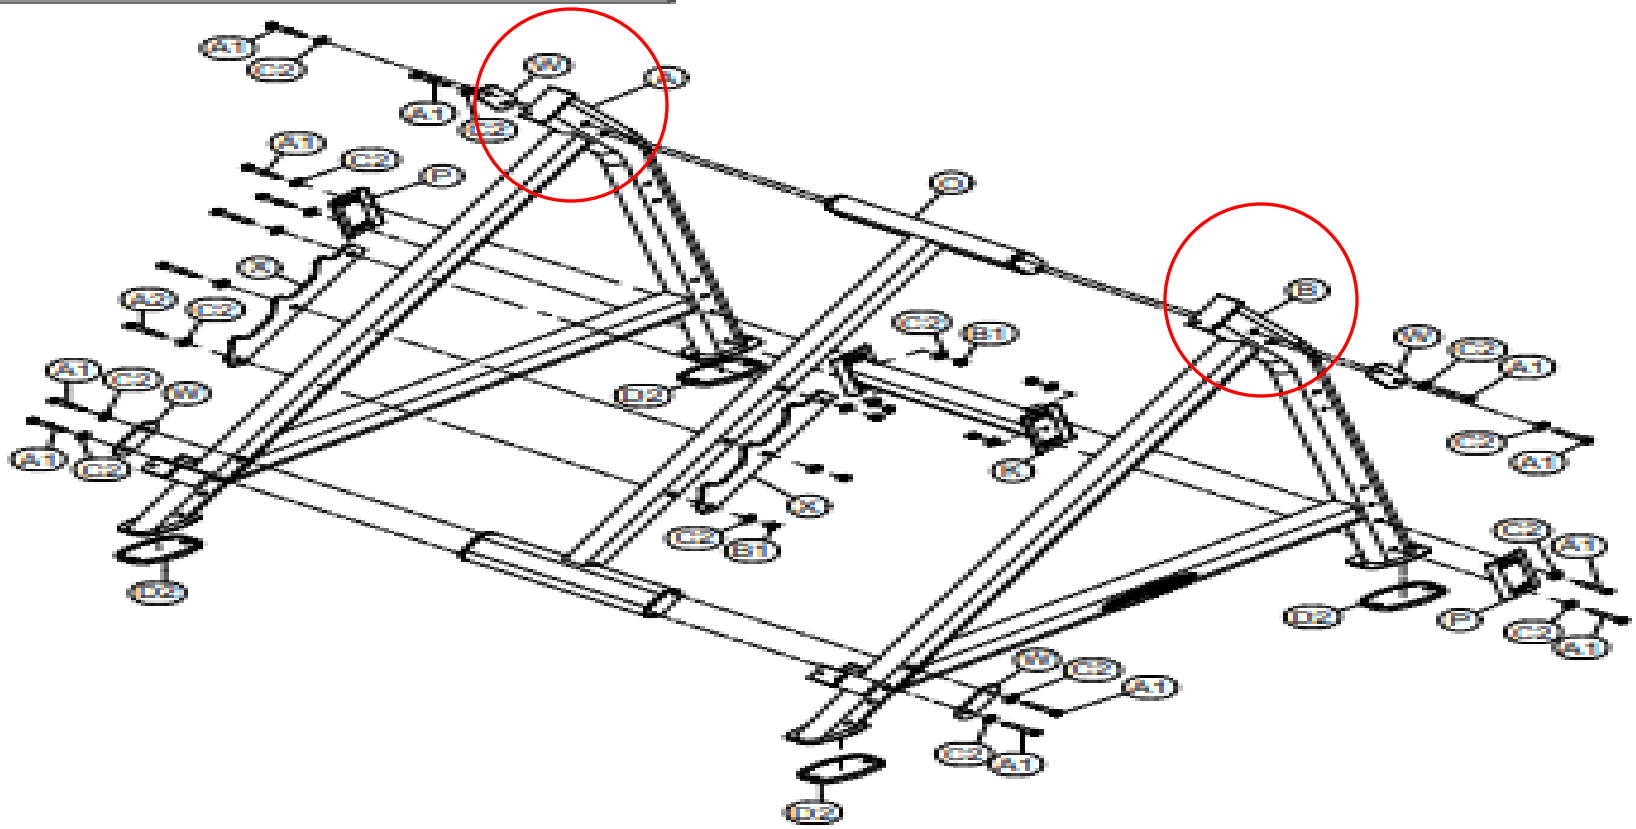


STEP 2

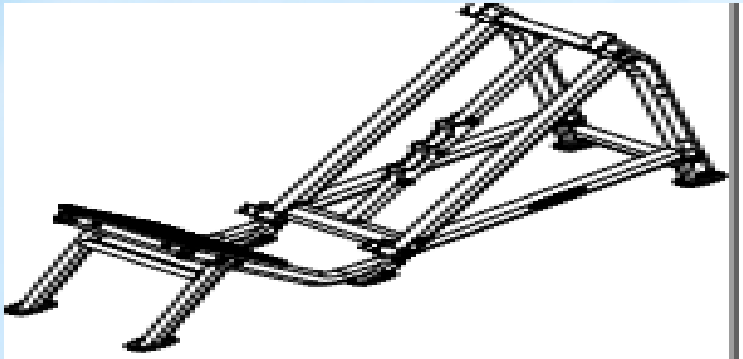


Above shows STEP 2 assembled and completed

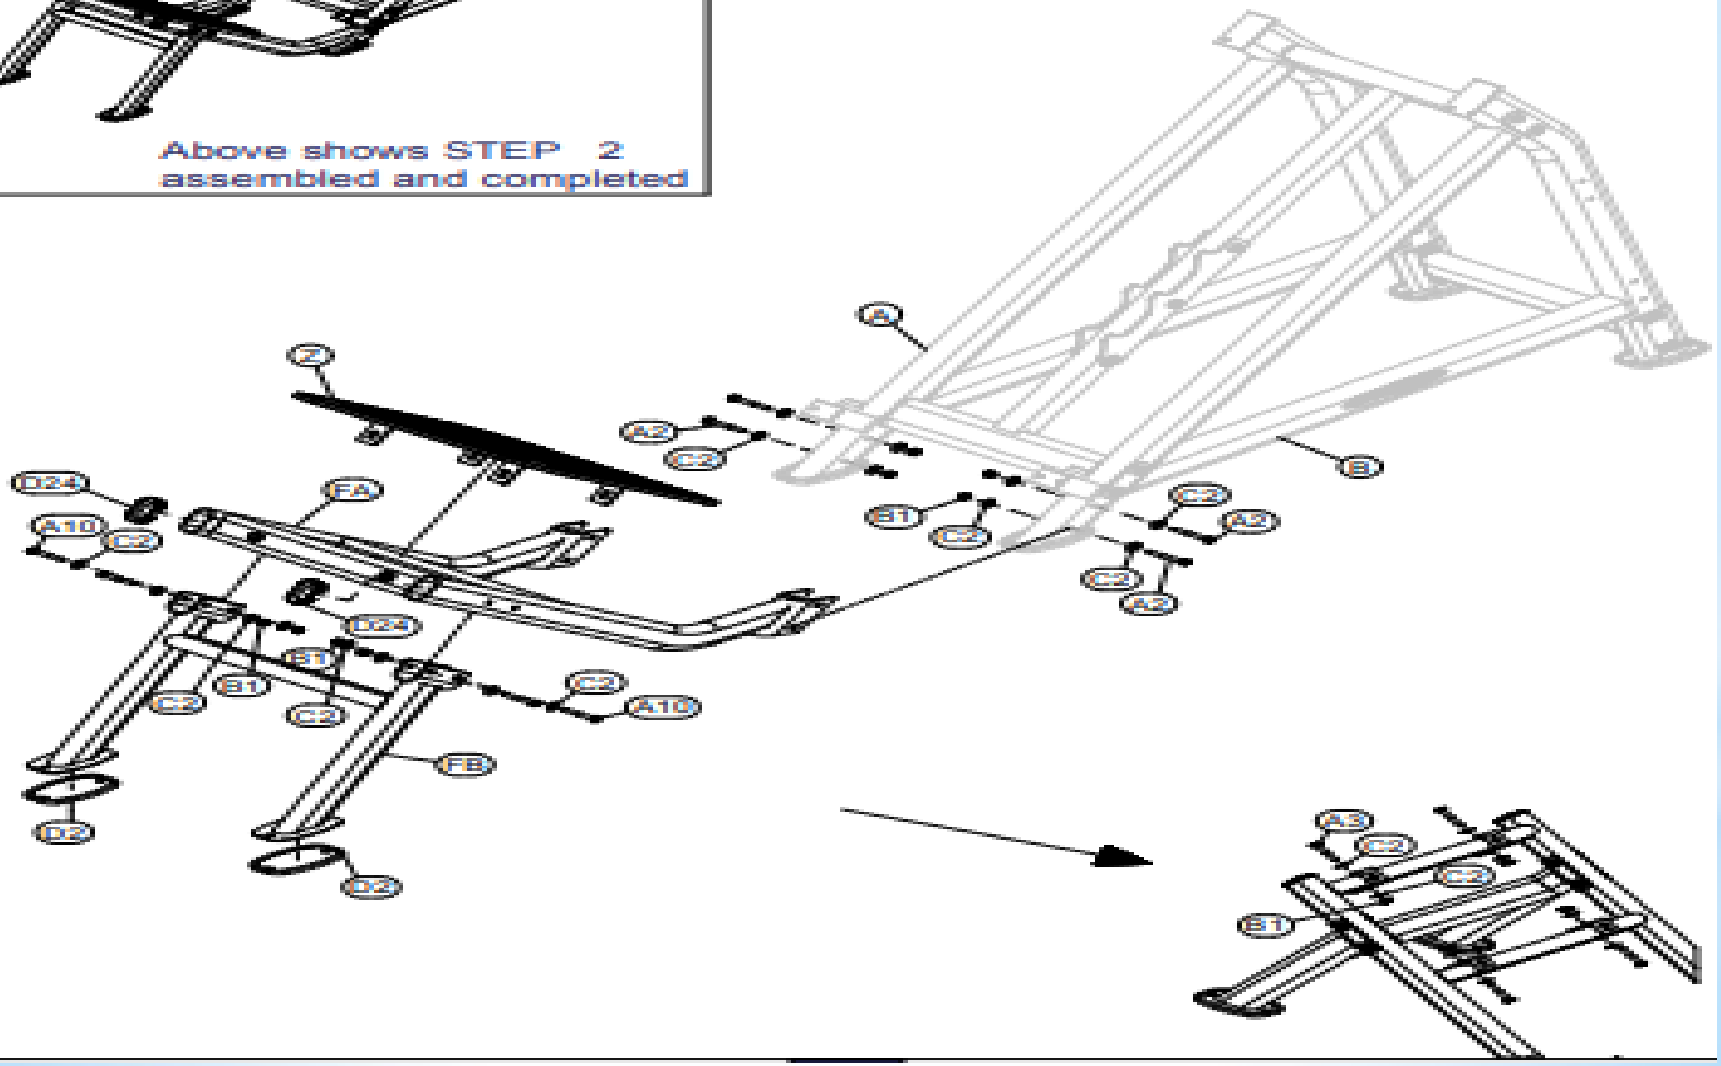


STEP 3

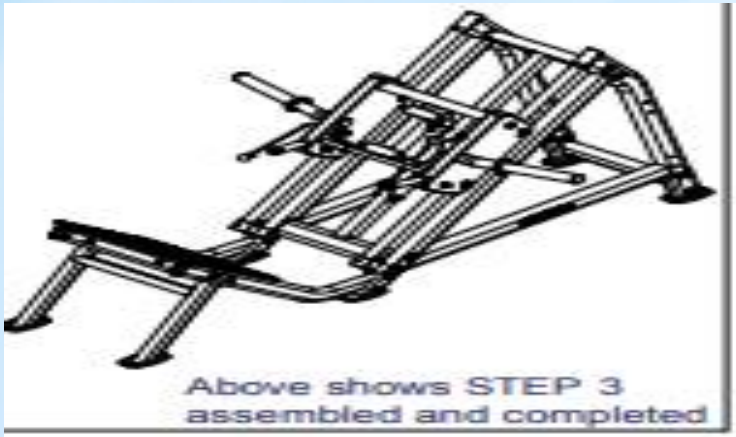


Above shows STEP 3 assembled and completed

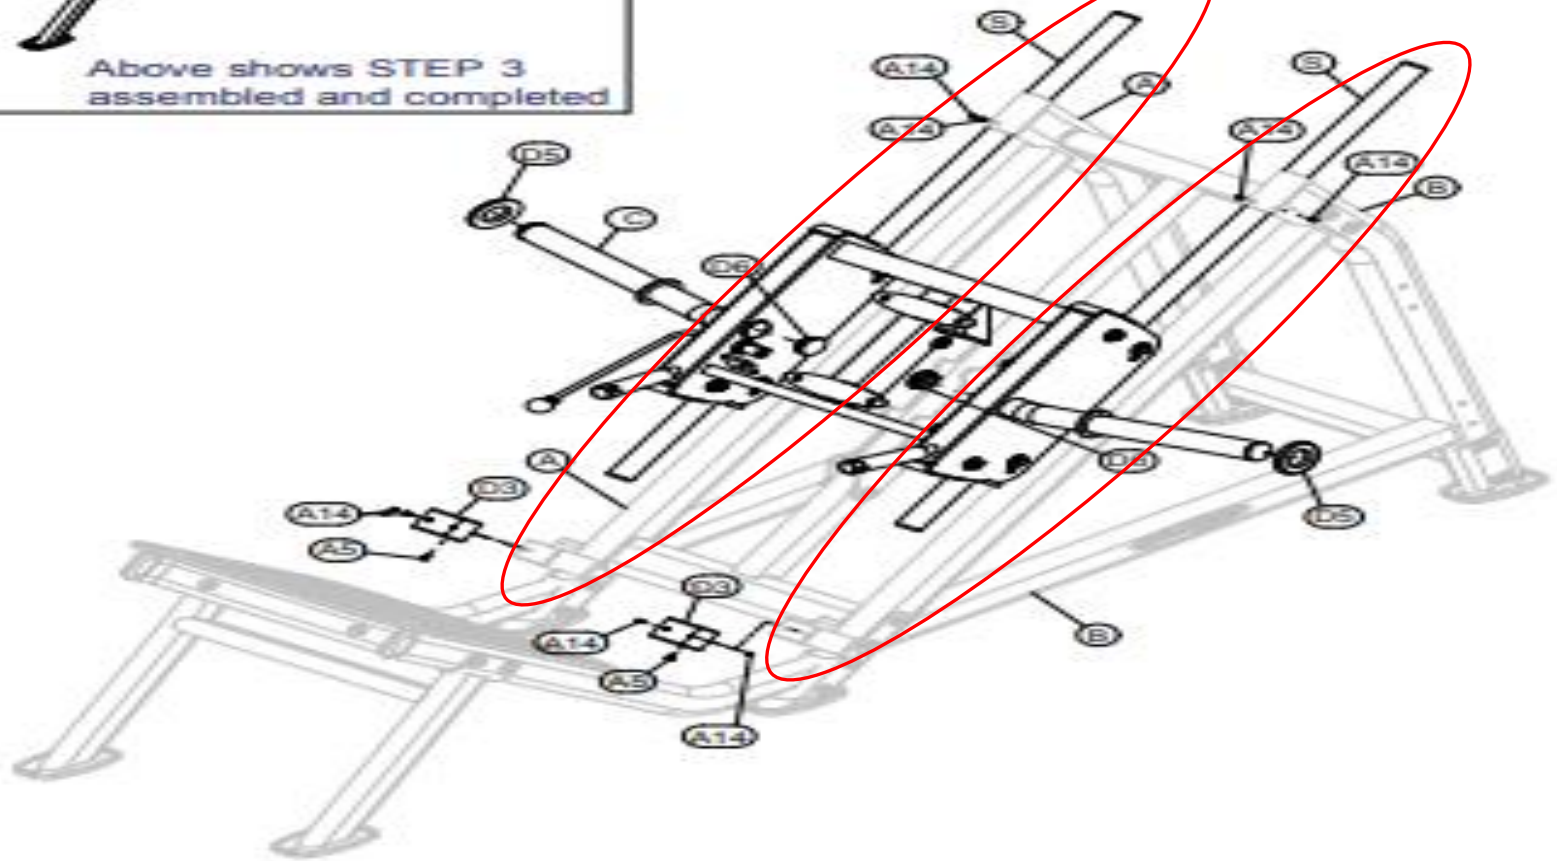


STEP 4

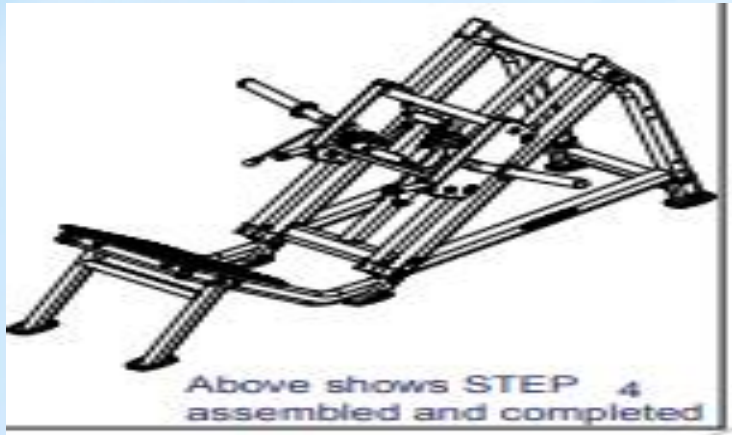


Above shows STEP 4 assembled and completed

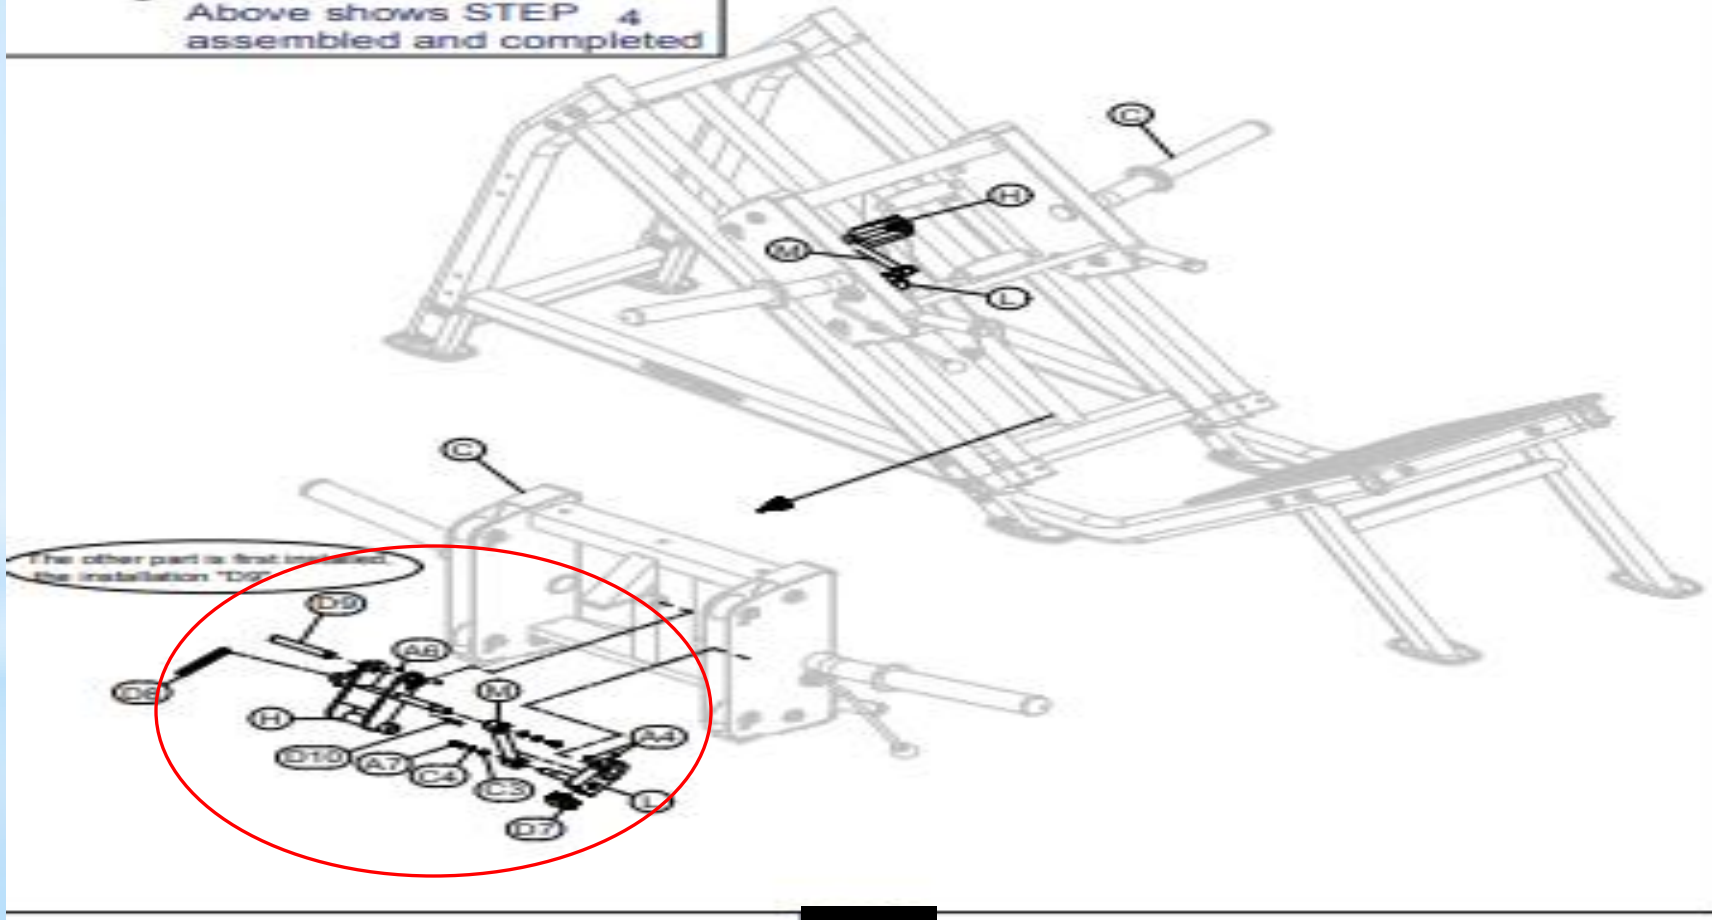

STEP 5

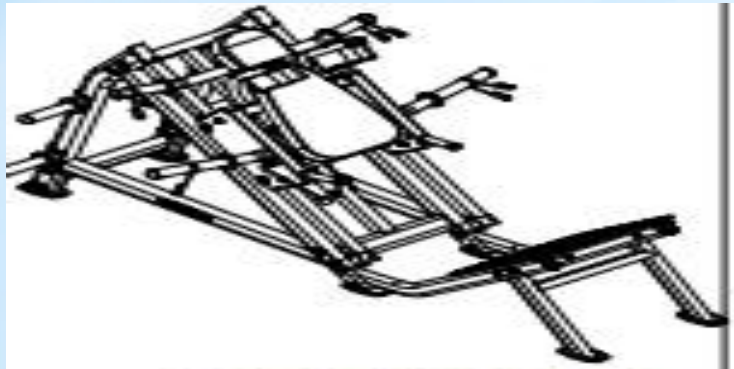

Above shows STEP 5 assembled and completed

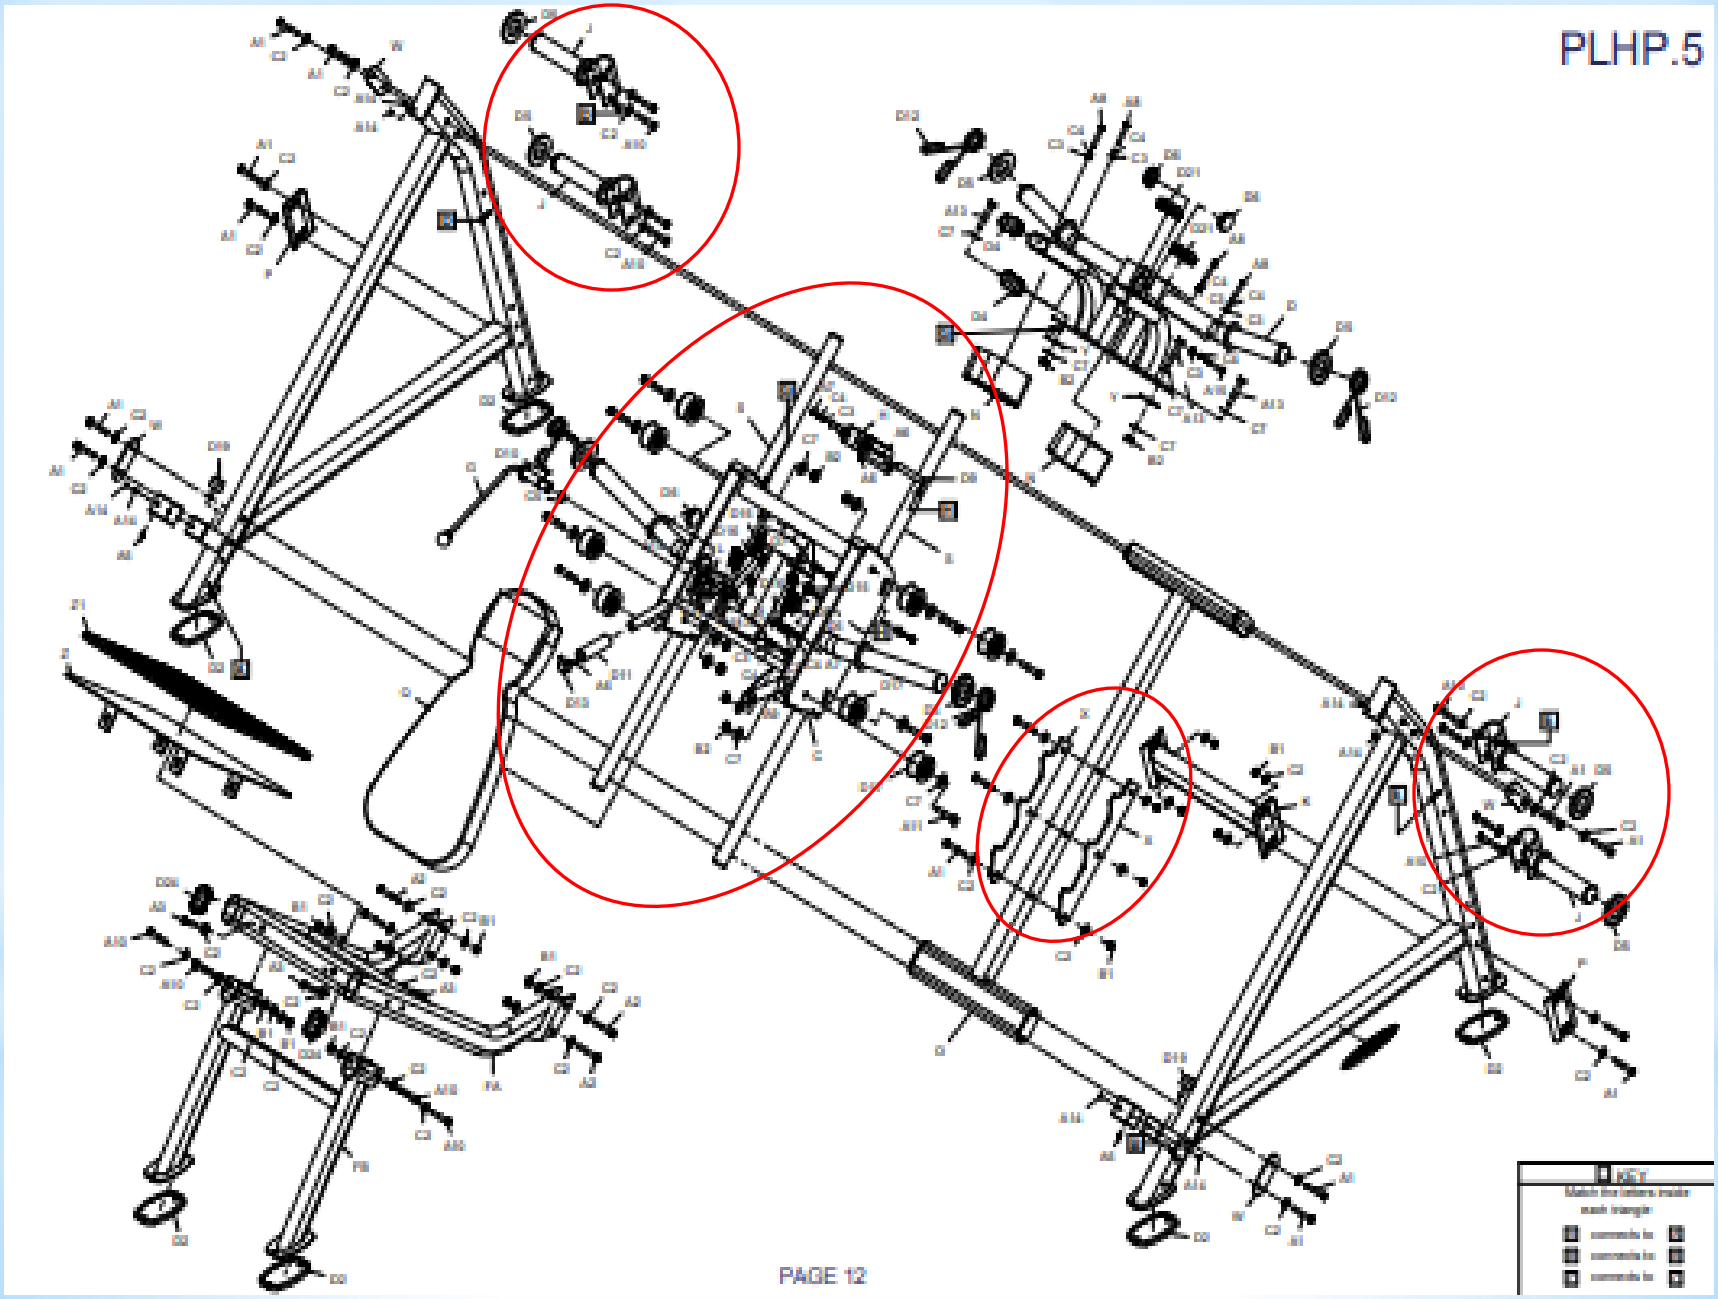
PLHP.5
KEY

*Well done!

