*PLSS Maintenance



* Customers can put some grease on pivot points(red circle place), with brass or gunmetal bushings.






* Let’s maintain your machine!


PLSS.1 HARDWARE

(shown in actual size)


A[1PCS]

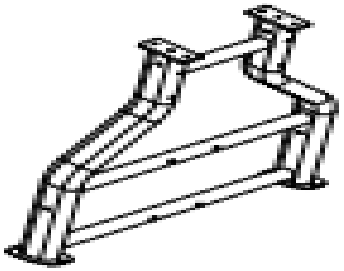

B[1PCS]




C[1PCS]

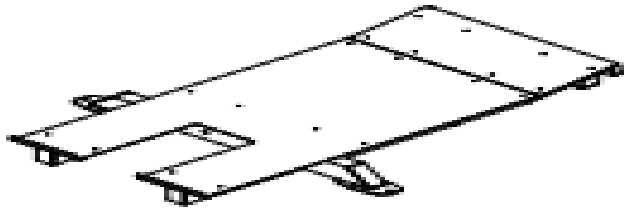

D[1PCS]

E[1PCS]


F[1PCS]

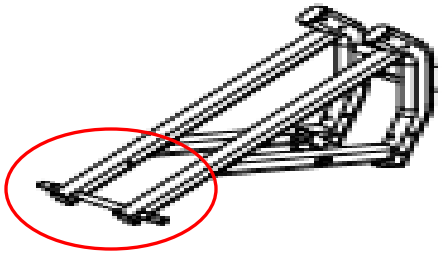


G[1PCS]




H[1PCS]

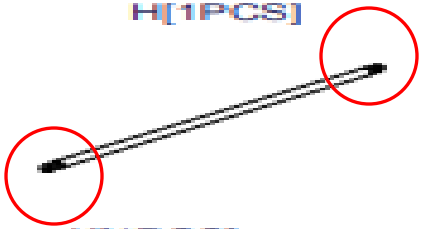

I[4PCS]

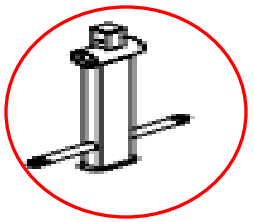


J[1PCS]



K[1PCS]



L[1PCS]

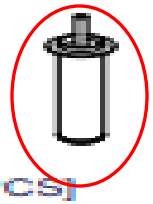

M[1PCS]



N[1PCS]




O[1PCS]





PLSS.1 HARDWARE
(shown in actual size)

P[1PCS]

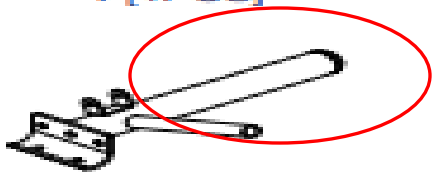

Q[1PCS]



U[4PCS]
(8343-163)



V[2PCS]
(8510-005)




W[1PCS]
(8830-042)




R[1PCS]
(9111-106)




S[2PCS]
(9131-066)

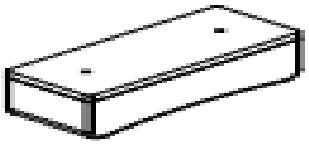


STEP 1

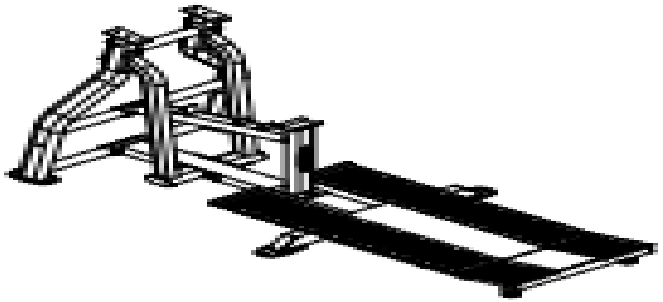


Above shows STEP 1 assembled and completed

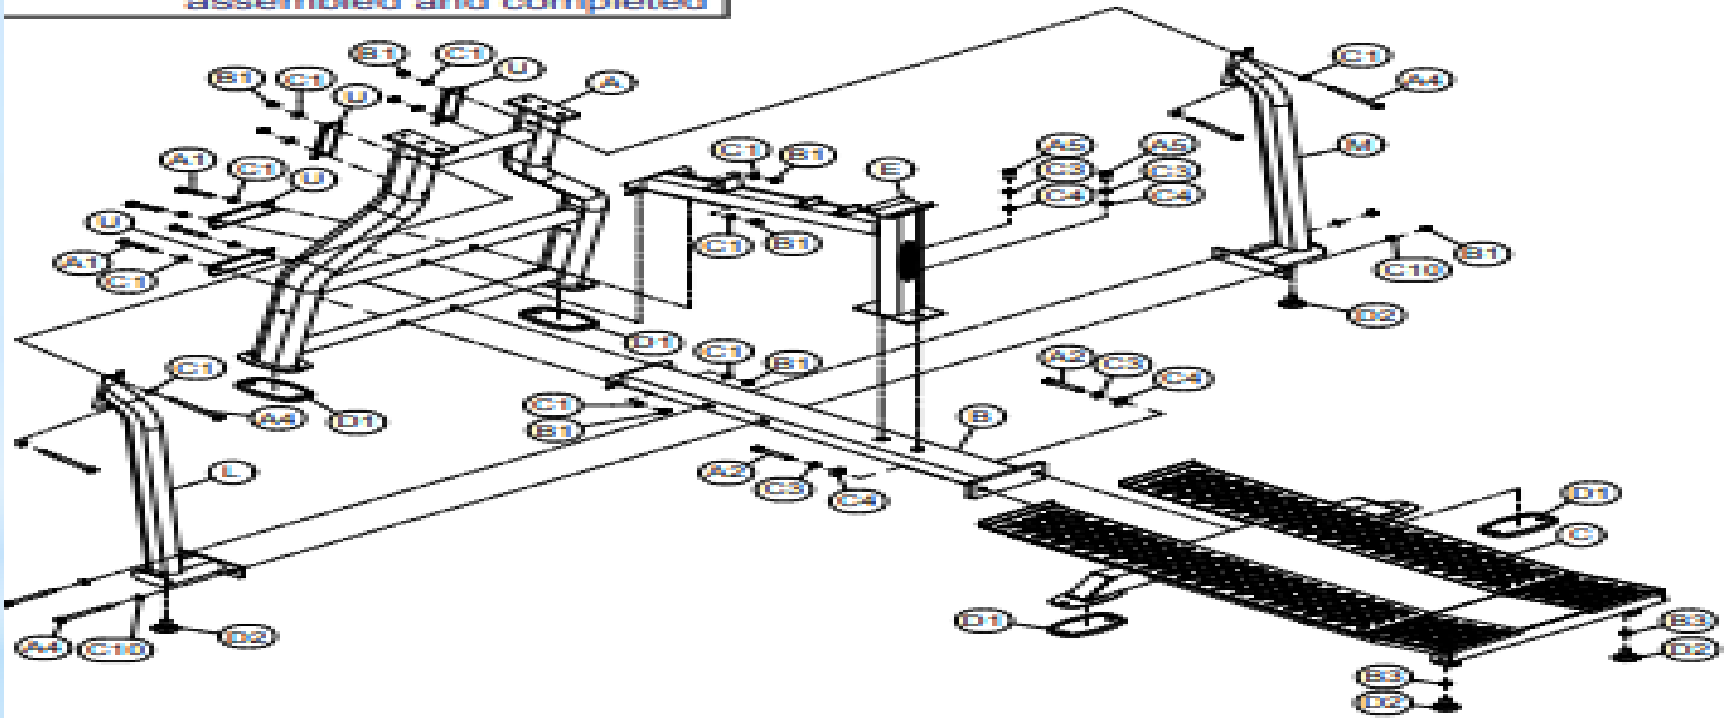


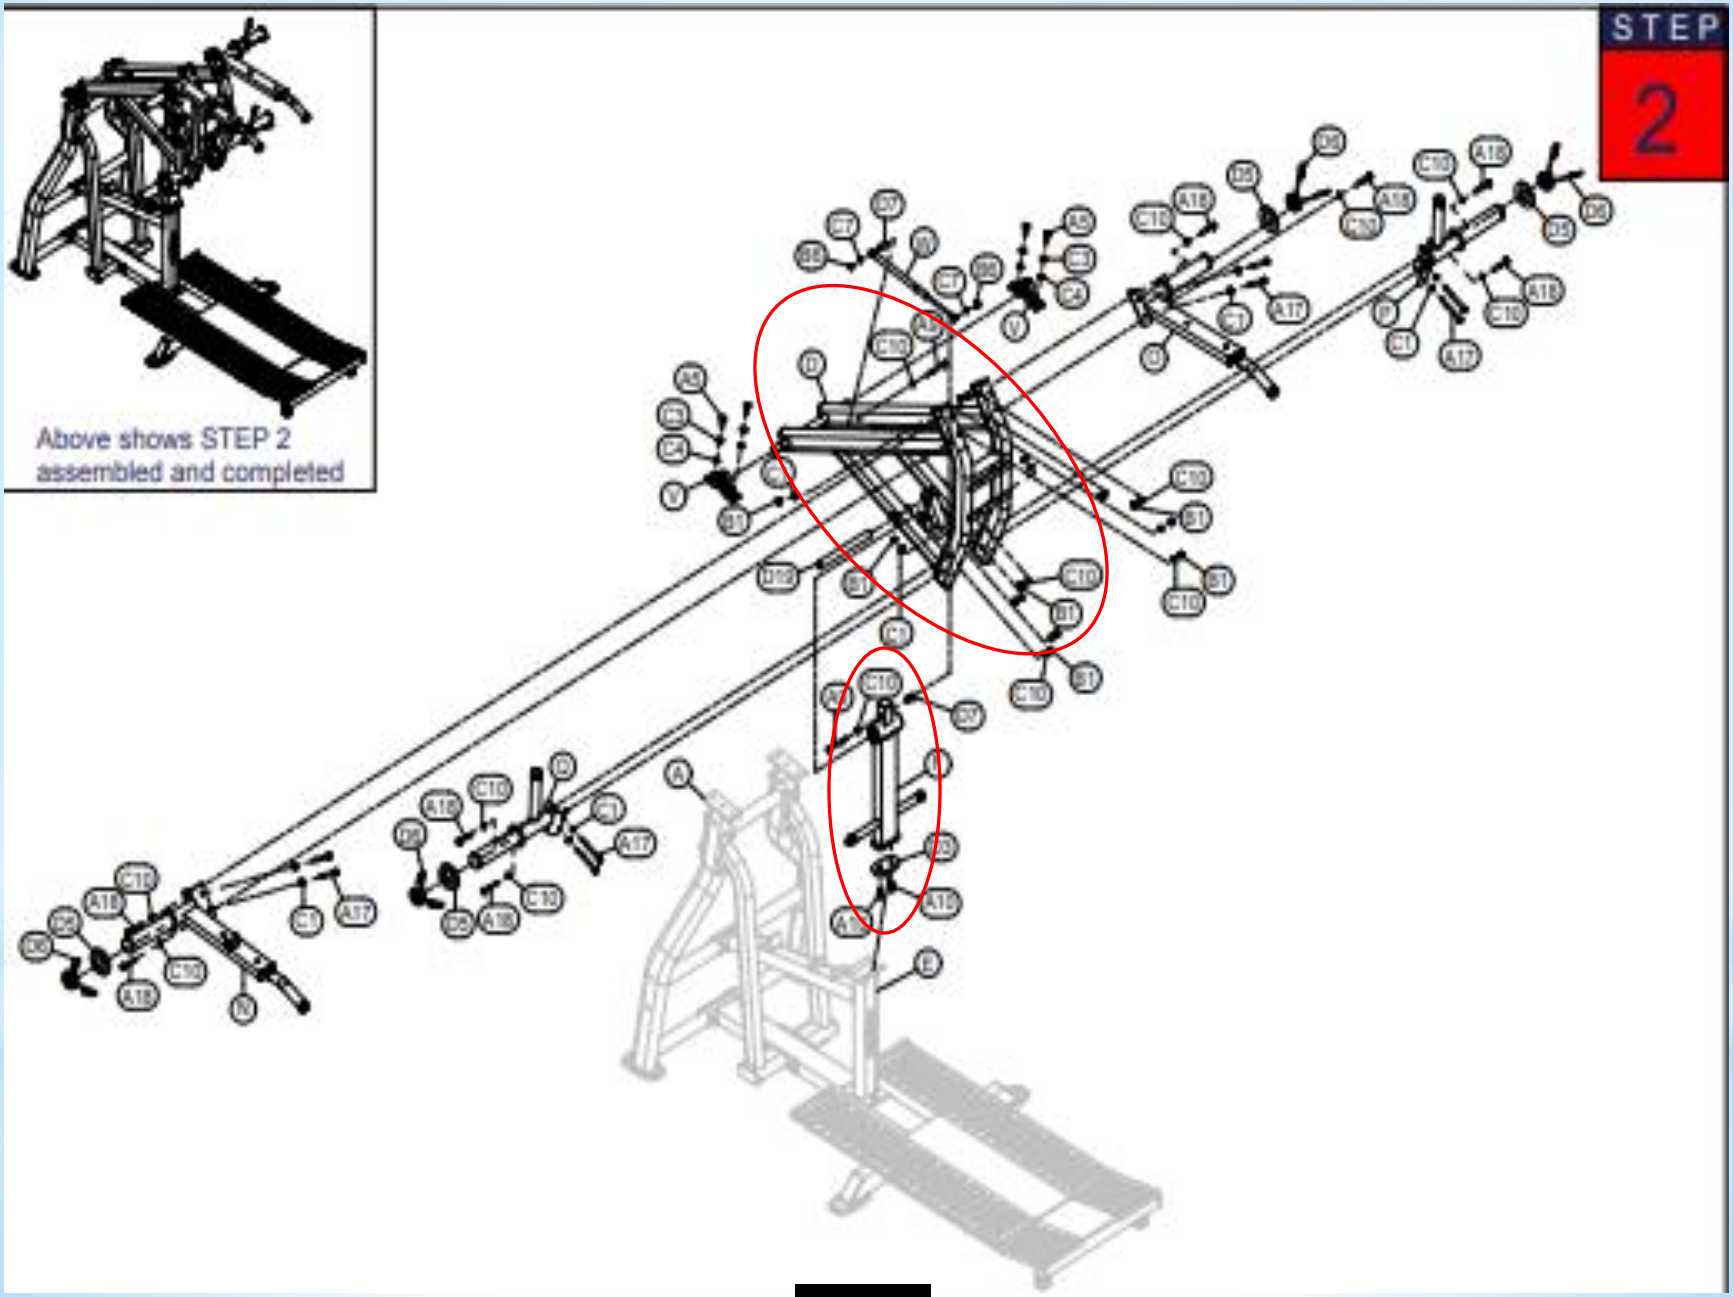
STEP
2
Above shows STEP 2
assembled and completed


STEP 3

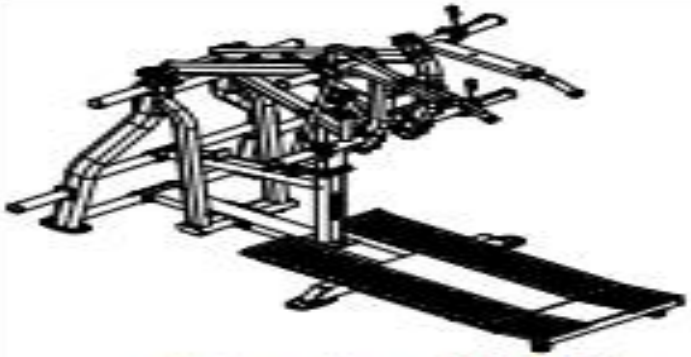


Above shows STEP 3 assembled and completed

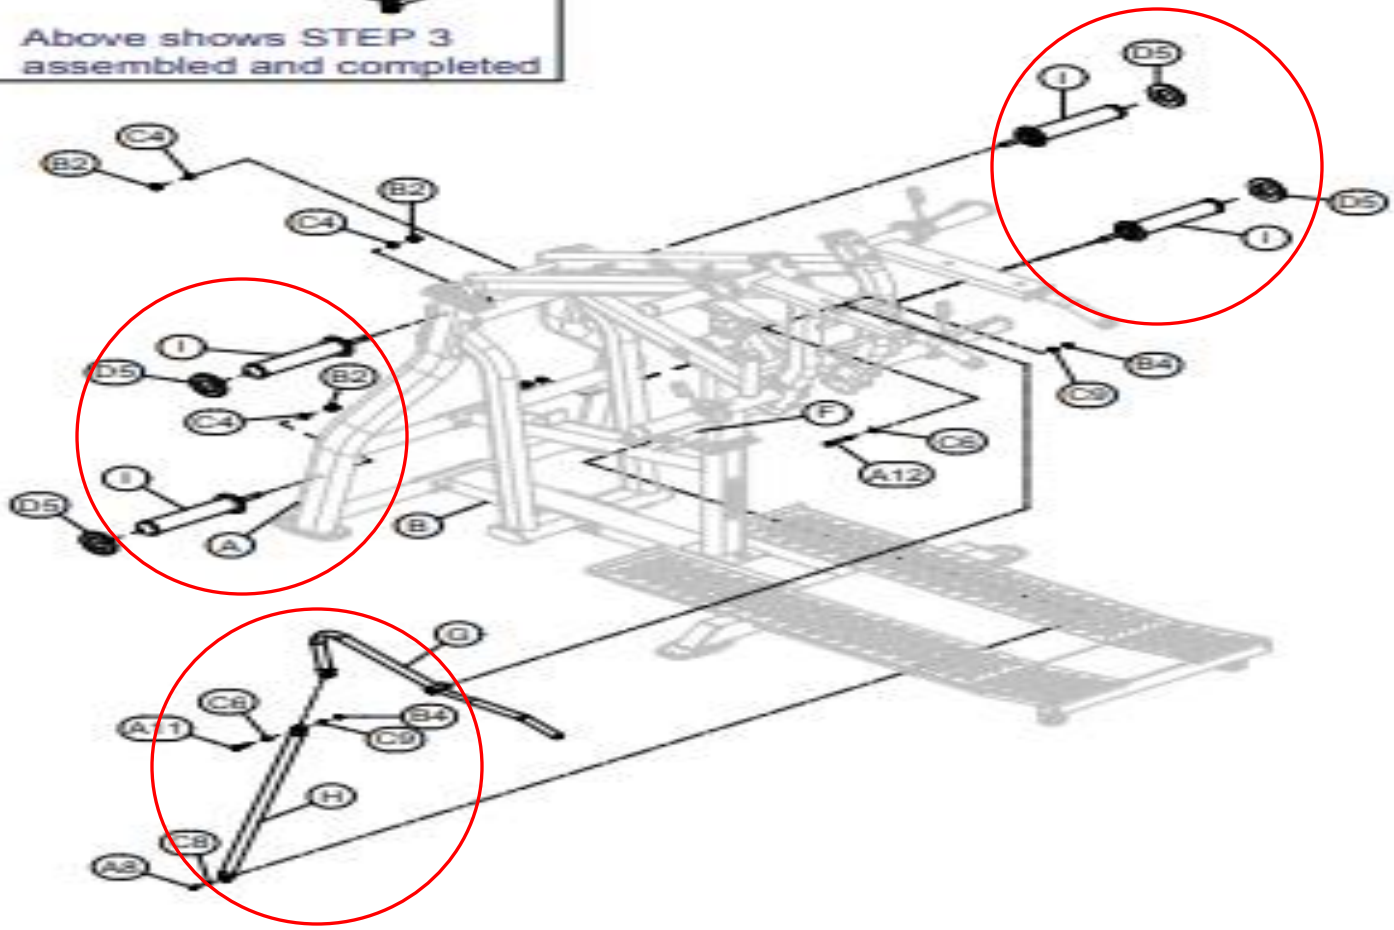


STEP 4

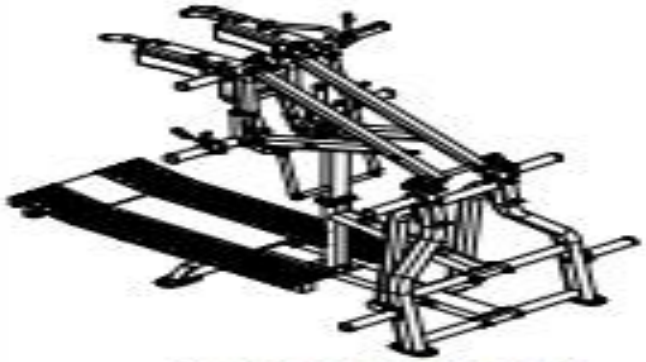

Above shows STEP 4 assembled and completed

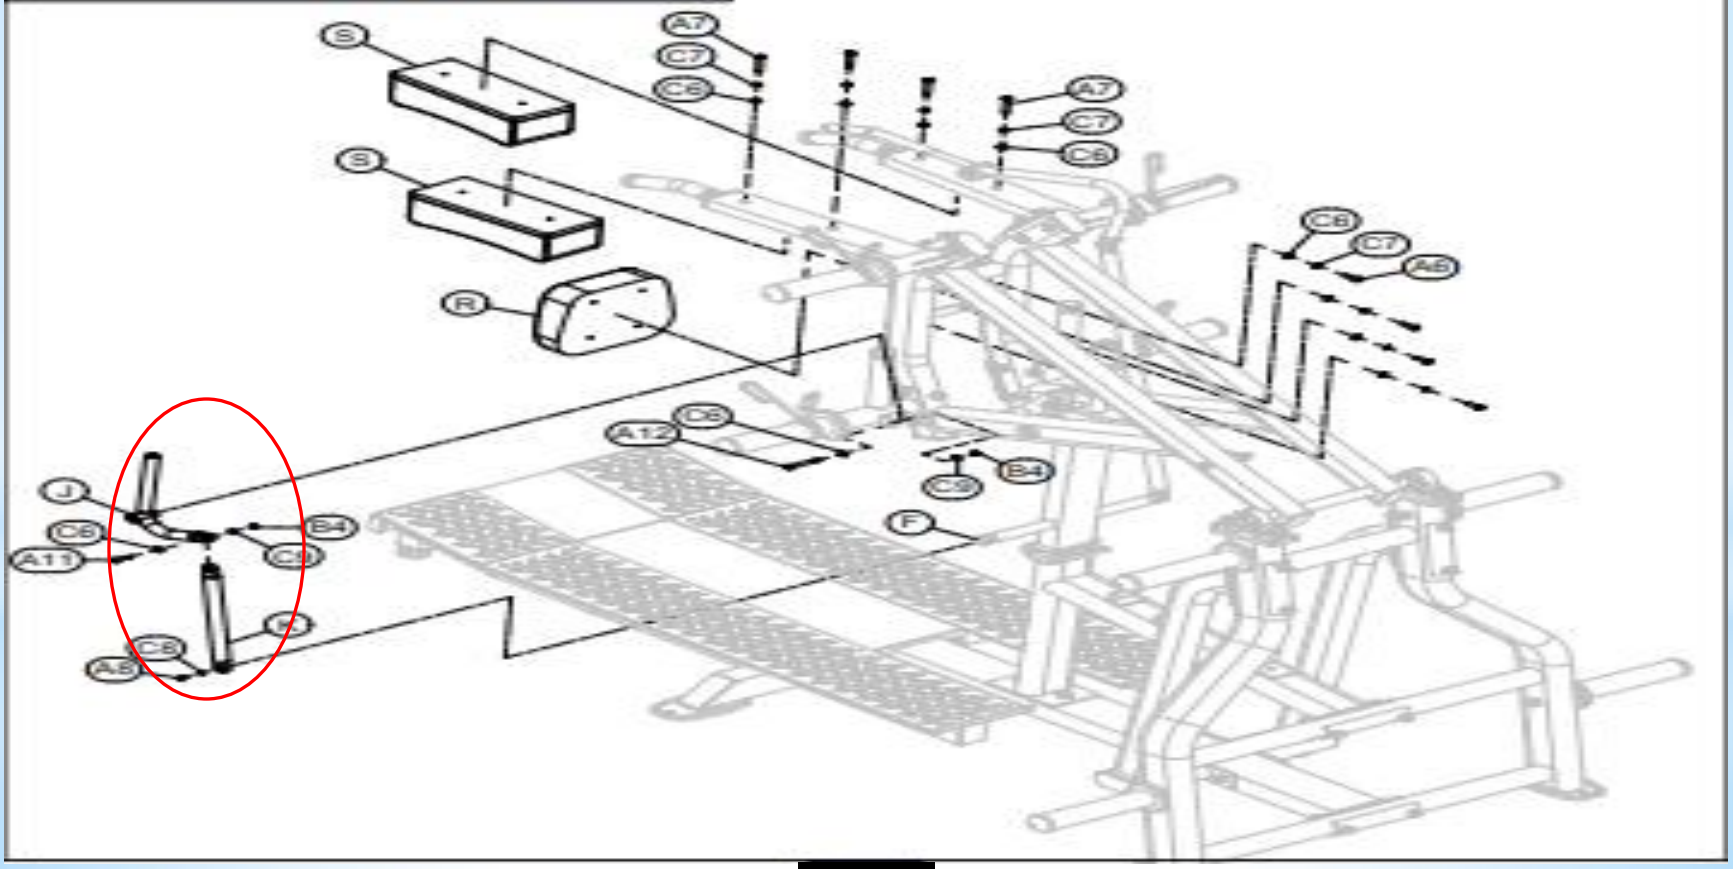

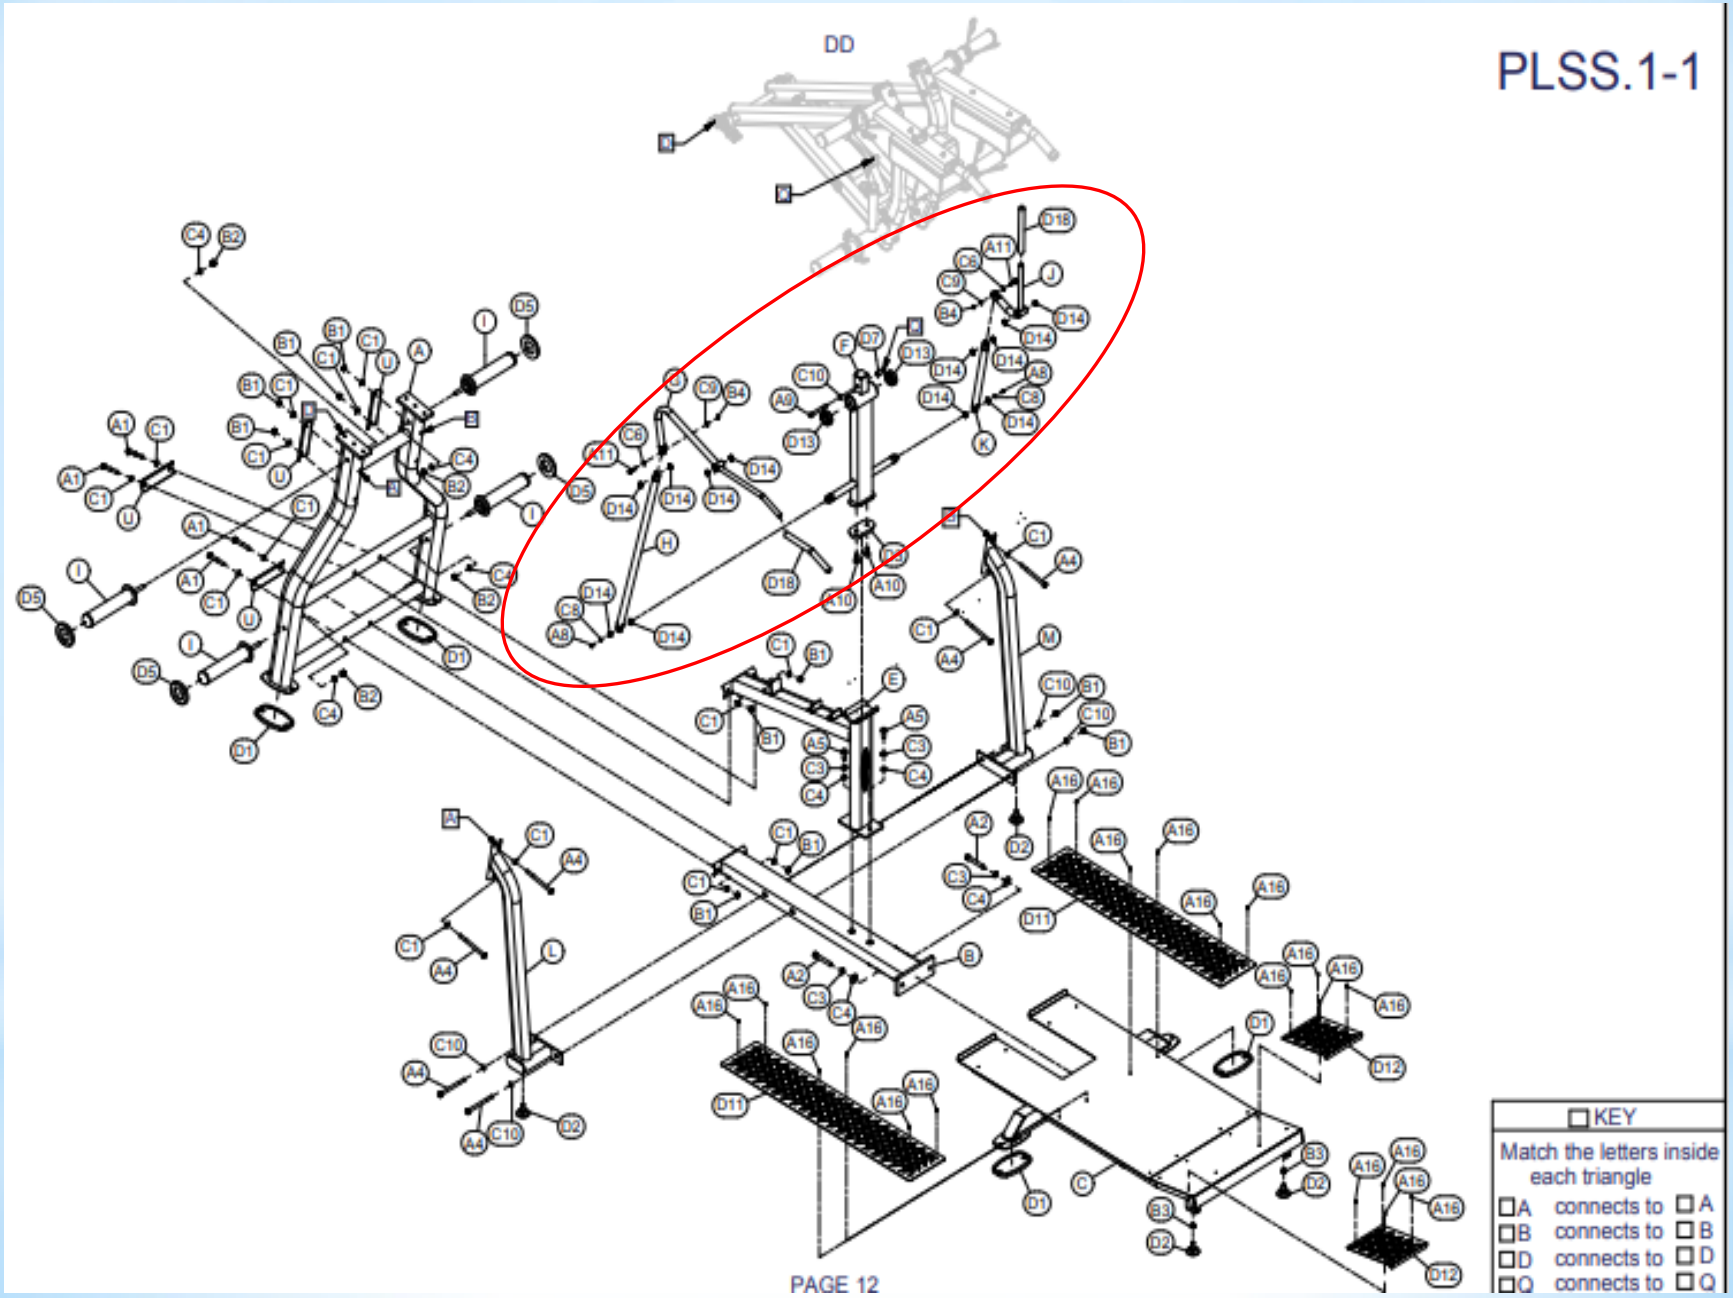
DD
PLSS.1-1
KEY
Match the letters inside each triangle
A connects to A
B connects to B
D connects to D
Q connects to Q
PAGE 12

*Well done!

